




TUBE WALL LIGHT, 2006

Satin Brass




OVERALL DIMENSIONS

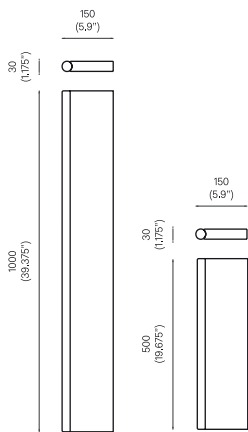


BACKPLATE DIMENSIONS

Please Verify the fixing holes position on the rear of the product before marking drilling holes.
Mounting screws not included.

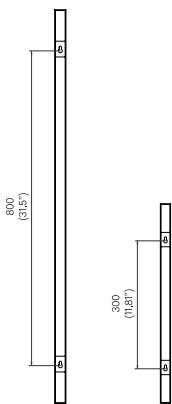


Dimensions may vary due to handmade product.

STANDARD MATERIAL/FINISH



CUSTOM FINISHES

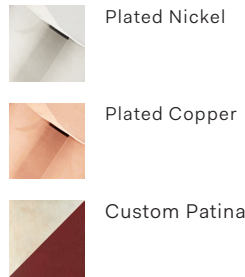

BULB SPECIFICATIONS

Bulb specifications 120V / 240V
S14s opal LED tube
Radium Raledina 15W / 1000mm ø29mm
1000lm / 2700K

Bulb specifications 240V
S14s opal LED tube
Radium Raledina 9W / 500mm ø29mm
450lm / 2700K
Bulb not supplied in 120V version

PRODUCT SPECIFICATIONS

Input voltage: 120V / 240V
Maximum wattage: 120W
120V / 240V dimmable LED triac
Product weight: 8kg
IP20

Input voltage: 120V / 240V
Maximum wattage: 60W
240V dimmable LED triac
Product weight: 5kg
IP20

CLEANING INSTRUCTIONS

Before cleaning, lighting fixtures must be turned off and unplugged from mains electricity. Whilst cleaning please take care and use the gloves provided.

Satin Brass: As the item is unlacquered it will naturally oxidise and darken. Upon touching the items without gloves, fingerprints are likely to occur and leave marks. Use a good quality brass cleaning liquid and follow the product instructions using the extra soft dust cloth. Do not apply pressure on persistent marks. Remove them using repeated gentle motions and by reapplying the brass cleaning liquid.

Plated Finish: Use a lightly damp soft dust cloth and gently go over marks until clean. Dry it afterwards with a soft dust cloth.

Patinated Finish: Use a dry soft dust cloth and gently go over marks until clean. The brass patina is achieved through an artisanal technique of applying pigments by hand during a hot patination process. Through this alchemic process, the brass is transformed whilst retaining the material's inherent qualities. It will mature and change overtime. The manner and speed in which it will change will depend on the environment, handling and the level and frequency of maintenance. Verdigris can also appear when the copper in the brass begins to oxidise.

Opaline Glass: Remove the opaline glass from the product. Using a lightly damp cloth, clean only the outside of the sphere. Only put the glass sphere back on the product once it is fully dry.